SRAC8

AC Input Step Motor Drive

Quick Set-Up Guide

Requirements

 
To use the SRAC8 Step Drive, the following items are needed:

- Universal AC input of 80 to 265 VAC
- Pulse & Direction signal
- A compatible step motor


Connect to Power

Use the supplied connector to connect to the AC supply according to the diagram below. Use 16 AWG wire for Line (L) and Neutral (N). Use 14 AWG for Earth Ground (G).

The SRAC8 has an internal 10A fast acting fuse.



Care should be taken when working with high voltages.

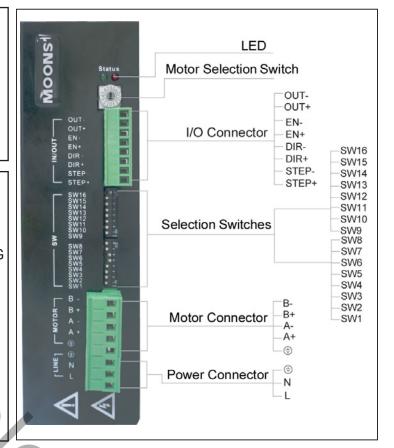


Connecting to a Motor


Connect the drive to the motor. Four lead




motors can be connected in only one way. If using a non MOONS' motor, consult the motor specs for wiring information.

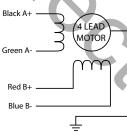


4-Lead Biploar Motor

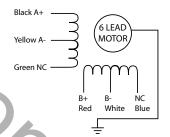


6-Lead Center Tap Connected

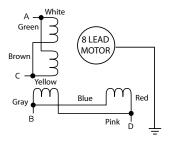

8-Lead Parallel Connected

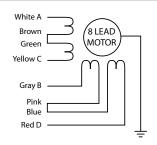

8-Lead Series Connected

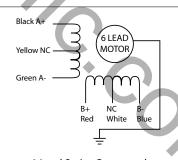

6-Lead Series Connected


Selecting the Motor

Each position of the 16-bit rotary selects a different motor, automatically setting the configuration parameters in the drive. The SRAC8 drive comes programmed with up to 16 typical motors as factory defaults. Drives can be customized with specially selected motors when required. Available options are listed on the drive label. Each motor in the loaded database has unique settings to optimize the anti-resonance.

If the motor selection is changed, the drive power supply will need to be cycled.

Selection **Switches**

Many operational parameters of the SRAC8 can be set or changed by position switches - either by a single switch or a combination of ON/ OFF settings of 2 or more switches.

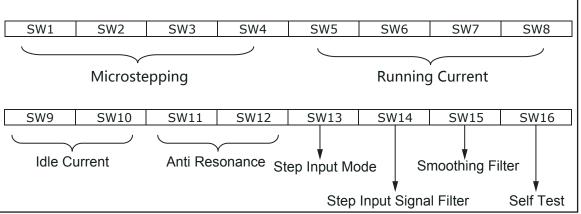

Microstenning - 4 switches for a total of 16 settings:

ivilciostepping - 4 switches for a total of to settings.						
Microstep(step/rev)	SW1	SW2	SW3	SW4		
200	ON	ON	ON	ON		
400	OFF	ON	ON	ON		
800	ON	OFF	ON	ON		
1600	OFF	OFF	ON	ON		
3200	ON	ON	OFF	ON		
6400	OFF	ON	OFF	ON		
12800	ON \P	OFF	OFF	ON		
25600	OFF	OFF	OFF	ON		
1000	ON	ON	ON	OFF		
2000	OFF	ON	ON	OFF		
4000	ON	OFF	ON	OFF		
5000	OFF	OFF	ON	OFF		
8000	ON	ON	OFF	OFF		
10000	OFF	ON	OFF	OFF		
20000	ON	OFF	OFF	OFF		
25000	OFF	OFF	OFF	OFF		

Idle Current - 2 switches for a total of 4 settings:

Idle	SW9	SW10
25%	ON	ON
50%	OFF	ON
70%	ON	OFF
90%	OFF	OFF

Step Input Mode (SW13) - OFF for Step and Direction input, ON for CW/CCW input

Step Smoothing Filter (SW15) - ON to enable, OFF to disable

Running current - 4 switches for a total of 16 settings:

Current(Peak)	SW5	SW6	SW7	SW8	
0.4A	ON	ON	ON	ON	
0.6A	OFF	ON	ON	ON	
0.9A	ON	OFF	ON	ON	
1.2A	OFF	OFF	ON	ON	
1.5A	ON	ON	OFF	ON	
2.0A	OFF	ON	OFF	ON	
2.5A	ON	OFF	OFF	ON	
3.0A	OFF	OFF	OFF	ON	
3.5A	ON	ON	ON	OFF	
4.0A	OFF	ON	ON	OFF	
4.5A	ON	OFF	ON	OFF	
5.2A	OFF	OFF	ON	OFF	
5.9A	ON	ON	OFF	OFF	
6.6A	OFF	ON	OFF	OFF	
7.3A	ON	OFF	OFF	OFF	
8.0A	OFF	OFF	OFF	OFF	

Anti-Resonance - 2 switches for a total of 4 settings:

Option	SW11	SW12	Inertia
0	ON	ON	Low
1	OFF	ON	
2	ON	OFF	↓
3	OFF	OFF	High

Step Input Signal Filter (SW14) - ON for 150 kHz. OFF for 2 MHz

Self test (SW16) - ON for 2 rev CW/CCW .5 rps self test, OFF for none

Safety Instructions



- Only qualified personnel should assemble, install, operate, or maintain this equipment.
- Read all available documentation before assembly and operation.
- It is vital to ensure that all system components are connected to earth ground.
- This product contains electrostatically sensitive components that can be damaged by incorrect handling.



Shanghai AMP & MOONS' Automation Co. Ltd.

No.168 Mingjia Road, Industrial Park North Minhang District, Shanghai 201107, P.R. China Tel: 86-21-52634688

Fax: 86-21-62968682

E-mail: info@moons.com.cn Web: www.moonsindustries.com

